

Aspen Condominium

Level 1 Reserve Study



Report Period – 01/01/2024 – 12/31/2024

Client Reference Number	19162
Property Type	Townhouse
Number of Units	14
Fiscal Year End	12/31

Type of Study	Full Study
Date of Property Inspection	10/25/2023
Prepared By	Dale Gifford
Analysis Method	Cash Flow
Funding Goal	Full Funding

Report prepared on – Thursday, October 26, 2023



TEL: (888) 356-3783 | Fax: (866) 279-9662
WWW.COMPLEXSOLUTIONSLTD.COM

Table of Contents

Introduction

- Executive Summary page 1
- Introduction page 2
- General Information and Frequently Asked Questions page 3 - 4

Reserve Analysis

- Funding Summary page 5
- Percent Funded – Graph page 6
- Component Inventory page 7
- Significant Components page 8
- Significant Components – Graph page 9
- Yearly Summary page 10
- Yearly Reserve Contributions – Graph page 11
- Component Funding Information page 12
- Yearly Cash Flow page 13
- Yearly Reserve Expenditures – Graph page 14
- Projected Reserve Expenditures by Year page 15

Component Evaluation

- Component Evaluation page 1 - 16

Glossary of Commonly used Words and Phrases

Executive Summary – Aspen Condominium - ID # 19162

Information to complete this Reserve Study was gathered by performing an on-site inspection of the common area elements. In addition, we also obtained information by contacting any vendors and/or contractors that have worked on the property recently, as well as communicating with the property representative (BOD Member and/or Community Manager). To the best of our knowledge, the conclusions and recommendations of this report are considered reliable and accurate insofar as the information obtained from these sources.

Projected Starting Balance as of 01/01/2024	\$18,098.86
Ideal Reserve Balance as of 01/01/2024	\$274,905
Percent Funded as of 01/01/2024	7%
Recommended Reserve Contribution (per month)	\$2,760
Recommended Special Assessment 2024	\$110,000

Aspen Condominium is a 14-unit Townhome community. The community offers landscaped areas as amenities. Construction on the community was completed in 1973.

Currently Programmed Projects

There are no projects programmed to occur this fiscal year (FY2024). (See page 15)

Significant Reserve Projects

The association's significant reserve projects are roofs replace (Comp# 105), building exteriors repaint (Comp# 217), asphalt major rehab (Comp# 401), and asphalt seal coat (Comp# 402). The fiscal significance of these components is approximately 37%, 17%, 13%, and 9% respectively (see page 9). A component's significance is calculated by dividing its replacement cost by its useful life. In this way, not only is a component's replacement cost considered but also the frequency of occurrence. These components most significantly contribute to the total monthly reserve contribution. As these components have a high level of fiscal significance the association should properly maintain them to ensure they reach their full useful lives.

Reserve Funding

In comparing the projected starting reserve balance of \$18,098.86 versus the ideal reserve balance of \$274,905 we find the association's reserve fund to be approximately 7% funded. This indicates a weak reserve fund position. In order to continue to strengthen the account fund, we suggest adopting a monthly reserve contribution of \$2,760 (\$197.14/unit) per month. If the contribution falls below this rate, then the reserve fund may fall into a situation where special assessments, deferred maintenance, and lower property values are likely at some point in the future.

Introduction

Reserve Study Purpose

The purpose of this Reserve Study is to provide the Association with a budgeting tool to help ensure that there are adequate reserve funds available to perform future reserve projects. The detailed schedules will serve as an advance warning that major projects will need to be addressed in the future. This will allow the Association to have ample time to obtain competitive bids for each project. It will also help to ensure the physical well-being of the property and ultimately enhance each owner's investment, while limiting the possibility of unexpected major projects that may lead to special assessments.

Preparer's Credentials

Mr. Gifford has been working in the community association industry since 2002. Prior to taking a position as the Regional Project Manager covering the Utah region at Complex Solutions in 2010, he worked in community association management in Utah. While in community association management his positions included, Maintenance Supervisor, Senior Portfolio Manager and Vice President of Community Management. His work in community association management gave him extensive experience with budget creation, reserves and reserve budgeting, community inspections, and analyzing common area components.

- Personally, has prepared over 2,200 reserve studies in Utah
- Member of the Association of Professional Reserve Analysts (APRA).
- Professional Reserve Analyst (PRA) designation from Association of Professional Reserve Analysts (APRA), PRA #2320
- Member of the Utah Chapter of Community Associations Institute (UCCAI). Current member of the CAI Utah Legislative Action Committee. Former Board member, and former Utah Chapter President
- Reserve Specialist (RS) designation from Community Associations Institute (CAI), RS# 231
- Bachelor of Science in Chemistry from Emporia State University
- Professional Community Association Manager® (PCAM®) designation from Community Associations Institute (CAI), PCAM# 1740
- Association Management Specialist® (AMS®) designation from Community Associations Institute (CAI)

Budget Breakdown

Every association conducts their business within a budget. There are typically two main parts to this budget, the Operating budget and the Reserve budget. The operating budget includes all expenses that occur on an annual basis as well as general maintenance and repairs. Typical operating budget line items include management fees, maintenance expenses, utilities, etc. The reserve budget is primarily made up of replacement items such as roofing, fencing, mechanical equipment, etc., that do not normally occur on an annual basis.

Report Sections

Reserve Analysis: this section contains the evaluation of the association's reserve balance, income, and expenses. It includes a finding of the client's current reserve fund status (measured as percent funded) and a recommendation for an appropriate reserve allocation rate (also known as the funding plan).

Component Evaluation: this section contains information regarding the physical status and replacement cost of reserve components the association is responsible to maintain. It is important to understand that while the component inventory will remain relatively "stable" from year to year, the condition assessment and life estimates will most likely vary from year to year.

General Information and Frequently Asked Questions

Is it the law to have a Reserve Study conducted?

The Government requires a reserve study in approximately 20 states. Also, the Association's governing documents may require a reserve fund be established. This does not mean a Reserve Study is required, but how are you going to know if you have enough money in the reserve fund if you do not have the proper information?

Why is it important to perform a Reserve Study?

This report provides the essential information that is needed to guide the Association in establishing the reserve portion of the total monthly assessment. The reserve fund is critical to the future of the association because it helps ensure that reserve projects can be completed on time. When projects are completed on time, deferred maintenance and the lower property values that typically accompany it can be avoided. It is suggested that a third party professionally prepare the Reserve Analysis Study since there is no vested interest in the property.

After we have a Reserve Study, what do we do with it?

Please take the time to review the report carefully and make sure the component information is complete and accurate. If there are any inaccuracies, or changes such as a component that the association feels should be added, removed, or altered, please inform us immediately so we may revise the report. Use the report to help establish your budget for the upcoming fiscal year.

How often do we review and update our Reserve Study?

There is a misconception that a Reserve Study is good for an extended period of time since the report has projections for a thirty year period. The assumptions, interest rates, inflation rates and other information used to create this report change each year. Scheduled events may not happen, unpredictable circumstances could occur, deterioration rates can be unpredictable and repair/replacement costs will vary from causes that are unforeseen. These variations alter the results of the Reserve Study. The Reserve Study should be professionally reviewed each year by having a Level III "no site visit" update reserve study performed. The Reserve Study should be professionally updated every three years by having a Level II "site visit" update reserve study performed.

What is a "Reserve Component" versus an "Operating Component"?

A "Reserve" component is an item that is the responsibility of the association to maintain, has a limited useful life, predictable remaining useful life, typically occurs on a cyclical basis that exceeds one year, and costs above a minimum threshold amount. An "Operating" component is typically a fixed expense that occurs on an annual basis.

What are the GREY areas of "maintenance" items that are often seen in a Reserve Study?

One of the most popular questions revolves around major "maintenance" items, such as painting the buildings or seal coating the asphalt. You may hear from your accountant that since painting or seal coating is not replacing a "capital" item, it cannot be considered a reserve component. However, it is the opinion of several major Reserve Study providers, including Complex Solutions, that these components meet the criteria of a reserve component.

Information and Data Gathered:

The information contained in this report is based on estimates and assumptions gathered from various sources. Estimated life expectancies are based upon conditions that were readily visible and accessible at the time of the site visit. While every effort has been made to ensure accurate results, this report reflects the judgment of Complex Solutions, Ltd. and should not be construed as a guarantee or assurance of predicting future events.

What happens during the Site Visit?

During the site visit we identify the common area components that we have determined require reserve funding. These components are quantified and a physical condition is observed. The site visit is conducted on the common areas as reported by client.

What is the Financial Analysis?

We project the starting balance by taking the most recent reserve fund balance as stated by the client and add expected reserve contributions to the end of the fiscal year. We then subtract the expenses of any pending projects. We compare this number to the Fully Funded Balance and arrive at the Percent Funded level. Based on that level of funding we then recommend a Funding Plan to help ensure the adequacy of funding in the future.

Measures of reserve fund financial strength are as follows:

- 0% - 30% Funded** is considered a “weak” financial position. Associations that fall into this category are more likely to have special assessments and deferred maintenance. Action should be taken to improve the financial strength of the reserve fund.
- 31% - 69% Funded** is considered a “fair” financial position. Associations that fall into this category are less likely to experience special assessments and deferred maintenance than being in a weak financial position. Action should be taken to improve the financial strength of the reserve fund.
- 70% - 99% Funded** is considered a “strong” financial position. Associations that fall into this category are less likely to experience special assessments and deferred maintenance than being in a fair financial position. Action should be taken to improve the financial strength of the reserve fund.
- 100% Funded** is considered an “ideal” financial position. Action should be taken to maintain the financial strength of the reserve fund.

Disclosures:

Information provided to the preparer of a reserve study by an official representative of the association regarding financial, historical, physical, quantitative or reserve project issues will be deemed reliable by the preparer. A reserve study will be a reflection of information provided to the preparer of the reserve study. The total of actual or projected reserves required as presented in the reserve study is based upon information provided that was not audited.

A reserve study is not intended to be used to perform an audit, an analysis of quality, a forensic study or a background check of historical records. An on-site inspection conducted in conjunction with a reserve study should not be deemed to be a project audit or quality inspection.

The results of this study are based on the independent opinion of the preparer and his experience and research during the course of his career in preparing Reserve Studies. In addition the opinions of experts on certain components have been gathered through research within their industry and with client’s actual vendors. There is no implied warranty or guarantee regarding our life and cost estimates/predictions. There is no implied warranty or guarantee in any of our work product. Our results and findings will vary from another preparer’s results and findings. A Reserve Study is necessarily a work in progress and subsequent Reserve Studies will vary from prior studies.

The projected life expectancy of the reserve components and the funding needs of the reserves of the association are based upon the association performing appropriate routine and preventative maintenance for each component. Failure to perform such maintenance can negatively impact the remaining useful life of the component and dramatically increase the funding needs of the reserves of the association.

This Reserve Study assumes that all construction assemblies and components identified herein are built properly and are free from defects in materials and/or workmanship. Defects can lead to reduced useful life and premature failure. It was not the intent of this Reserve Study to inspect for or to identify defects. If defects exist, repairs should be made so that the construction components and assemblies at the community reach the full and expected useful lives.

Site Visits: Should a site visit have been performed during the preparation of this reserve study no invasive testing was performed. The physical analysis performed during the site visit was not intended to be exhaustive in nature and may have included representative sampling. Estimated life expectancies and life cycles are based upon conditions that were readily accessible and visible at the time of the site visit. We have assumed any and all components have been properly built and will reach normal, typical life expectancies. A reserve study is not intended to identify or fund for construction defects. We did not and will not look for or identify construction defects during our site visit. In addition, environmental hazards (such as lead paint, asbestos, radon, etc.), have been excluded from this report.

Update Reserve Studies:

Level II Studies: Quantities of major components as reported in previous reserve studies are deemed to be accurate and reliable. The reserve study relies upon the validity of previous reserve studies.

Level III Studies: In addition to the above we have not visited the property when completing a Level III “No Site Visit” study. Therefore we have not verified the current condition of the components.

Insurance: We carry general and professional liability insurance as well as workers’ compensation insurance.

Actual or Perceived Conflicts of Interest: There are no potential actual or perceived conflicts of interest that we are aware of.

Inflation and Interest Rates: The after tax interest rate used in the financial analysis may or may not be based on the clients reported after tax interest rate. If it is, we have not verified or audited the reported rate. The inflation rate may also be based on an amount we believe appropriate given the 30-year horizon of this study and may or may not reflect current or historical inflation rates.

Funding Summary

Beginning Assumptions

# of units	14
Fiscal Year End	31-Dec
2024 Special Assessment	\$110,000
Budgeted Monthly Reserve Allocation	\$0
Projected Starting Reserve Balance	\$18,099
Ideal Starting Reserve Balance	\$274,905

Economic Assumptions

Projected Inflation Rate	4.00%
Reported After-Tax Interest Rate	0.10%

Current Reserve Status

Current Balance as a % of Ideal Balance	7%
---	----

Recommendations

Recommended Monthly Reserve Allocation	\$2,760
Per Unit	\$197.14
Future Annual Increases	3.00%
For number of years:	30
Increases thereafter:	0.00%
70% Funded Monthly Reserve Allocation Reference	\$2,555
Per Unit	\$182.50
Future Annual Increases	3.00%
For number of years:	30
Increases thereafter:	0.00%

Changes From Prior Year

Recommended Increase to Reserve Allocation as Percentage	\$2,760 0%
---	---------------

Component Inventory


Category	ID #	Component Name	Useful Life (yrs.)	Remaining Useful Life (yrs.)	Best Cost	Worst Cost
Roofing	105	Roofs - Replace	25	3	\$146,000	\$176,000
	120	Rain Gutters/Downspouts - Replace	30	6	\$12,000	\$15,000
Painted Surfaces	204	Front Doors - Repaint	10	5	\$2,000	\$3,000
	212	Balcony Railing - Repaint	N/A		\$0	\$0
	217	Building Exteriors - Repaint	8	3	\$20,000	\$26,000
Siding Materials	302	Vinyl Siding - Replace	50	30	\$12,000	\$18,000
Drive Materials	401	Asphalt - Major Rehab	30	10	\$60,000	\$70,000
	402	Asphalt - Seal Coat	5	2	\$7,000	\$9,000
	403	Concrete - Partial Repair/Replace	10	3	\$2,000	\$3,000
Decking	607	Balcony Decks - Replace	30	10	\$2,000	\$3,000
	690	Balcony Railing - Replace	50	10	\$4,000	\$5,000
Prop. Identification	801	Monument Sign - Replace	N/A		\$0	\$0
Fencing	1003	Chain Link Fencing - Replace	40	20	\$45,000	\$60,000
Recreation Equip.	1306	Picnic Table - Replace	N/A		\$0	\$0
Light Fixtures	1602	Exterior Light Fixtures - Replace	20	3	\$10,000	\$13,000
Landscaping	1812	Landscaping & Irrigation System - Renov	20	9	\$15,000	\$20,000



Significant Components

ID #	Component Name	Useful Life (yrs.)	Remaining Useful Life (yrs.)	Average Current Cost	Significance: (Curr Cost/UL)	
					As \$	As %
105	Roofs - Replace	25	3	\$161,000	\$6,440	37.2955%
120	Rain Gutters/Downspouts - Replace	30	6	\$13,500	\$450	2.6061%
204	Front Doors - Repaint	10	5	\$2,500	\$250	1.4478%
217	Building Exteriors - Repaint	8	3	\$23,000	\$2,875	16.6498%
302	Vinyl Siding - Replace	50	30	\$15,000	\$300	1.7374%
401	Asphalt - Major Rehab	30	10	\$65,000	\$2,167	12.5477%
402	Asphalt - Seal Coat	5	2	\$8,000	\$1,600	9.2660%
403	Concrete - Partial Repair/Replace	10	3	\$2,500	\$250	1.4478%
607	Balcony Decks - Replace	30	10	\$2,500	\$83	0.4826%
690	Balcony Railing - Replace	50	10	\$4,500	\$90	0.5212%
1003	Chain Link Fencing - Replace	40	20	\$52,500	\$1,313	7.6010%
1602	Exterior Light Fixtures - Replace	20	3	\$11,500	\$575	3.3300%
1812	Landscaping & Irrigation System - Rend	20	9	\$17,500	\$875	5.0673%

Significant Components - Graph

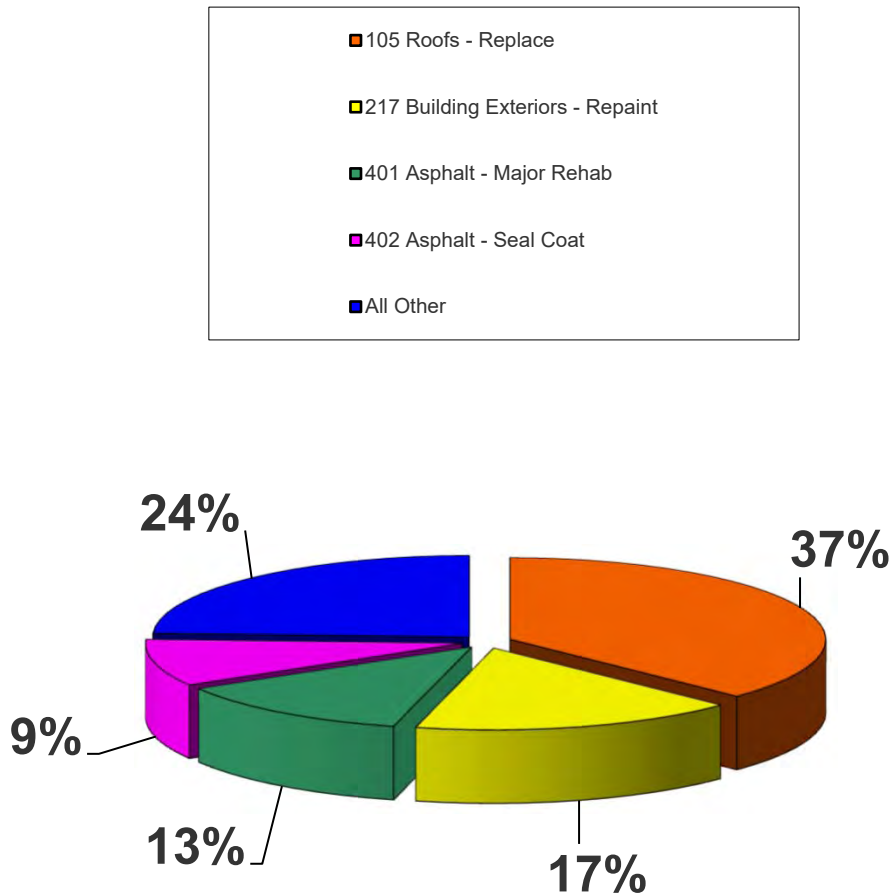

ID #	Component Name	Useful Life (yrs.)	Remaining Useful Life (yrs.)	Average Current Cost	Significance: (Curr Cost/UL)	
					As \$	As %
105	Roofs - Replace	25	3	\$161,000	\$6,440	37%
217	Building Exteriors - Repaint	8	3	\$23,000	\$2,875	17%
401	Asphalt - Major Rehab	30	10	\$65,000	\$2,167	13%
402	Asphalt - Seal Coat	5	2	\$8,000	\$1,600	9%
All Other	See Expanded Table For Breakdown				\$4,186	24%


Yearly Summary

Year	Fully Funded Balance	Starting Reserve Balance	% Funded	Reserve Contributions	Interest Income	Reserve Expenses	Ending Reserve Balance
2024	\$274,905	\$18,099	7%	\$33,120	\$145	\$0	\$51,364
2025	\$303,859	\$161,364	53%	\$34,114	\$179	\$0	\$195,656
2026	\$334,690	\$195,656	58%	\$35,137	\$209	\$8,653	\$222,349
2027	\$358,503	\$222,349	62%	\$36,191	\$129	\$222,723	\$35,946
2028	\$161,411	\$35,946	22%	\$37,277	\$55	\$0	\$73,278
2029	\$188,876	\$73,278	39%	\$38,395	\$91	\$3,042	\$108,722
2030	\$215,117	\$108,722	51%	\$39,547	\$120	\$17,082	\$131,307
2031	\$228,679	\$131,307	57%	\$40,733	\$146	\$10,527	\$161,660
2032	\$250,510	\$161,660	65%	\$41,955	\$183	\$0	\$203,798
2033	\$285,107	\$203,798	71%	\$43,214	\$213	\$24,908	\$222,317
2034	\$296,167	\$222,317	75%	\$44,511	\$191	\$106,578	\$160,441
2035	\$223,756	\$160,441	72%	\$45,846	\$166	\$35,407	\$171,045
2036	\$223,528	\$171,045	77%	\$47,221	\$188	\$12,808	\$205,647
2037	\$247,900	\$205,647	83%	\$48,638	\$228	\$4,163	\$250,350
2038	\$283,389	\$250,350	88%	\$50,097	\$276	\$0	\$300,722
2039	\$325,822	\$300,722	92%	\$51,600	\$324	\$4,502	\$348,144
2040	\$366,514	\$348,144	95%	\$53,148	\$375	\$0	\$401,667
2041	\$414,810	\$401,667	97%	\$54,742	\$421	\$15,583	\$441,248
2042	\$450,177	\$441,248	98%	\$56,385	\$470	\$0	\$498,102
2043	\$504,564	\$498,102	99%	\$58,076	\$503	\$48,458	\$508,224
2044	\$512,186	\$508,224	99%	\$59,818	\$481	\$115,034	\$453,489
2045	\$452,387	\$453,489	100%	\$61,613	\$485	\$0	\$515,586
2046	\$511,405	\$515,586	101%	\$63,461	\$538	\$18,959	\$560,626
2047	\$554,703	\$560,626	101%	\$65,365	\$576	\$34,506	\$592,062
2048	\$585,266	\$592,062	101%	\$67,326	\$626	\$0	\$660,014
2049	\$654,709	\$660,014	101%	\$69,346	\$692	\$6,665	\$723,387
2050	\$721,840	\$723,387	100%	\$71,426	\$759	\$0	\$795,573
2051	\$800,502	\$795,573	99%	\$73,569	\$788	\$89,384	\$780,546
2052	\$791,343	\$780,546	99%	\$75,776	\$577	\$482,791	\$374,108
2053	\$374,745	\$374,108	100%	\$78,049	\$386	\$54,576	\$397,967



Reserve Contributions - Graph

Monthly Reserve Contributions

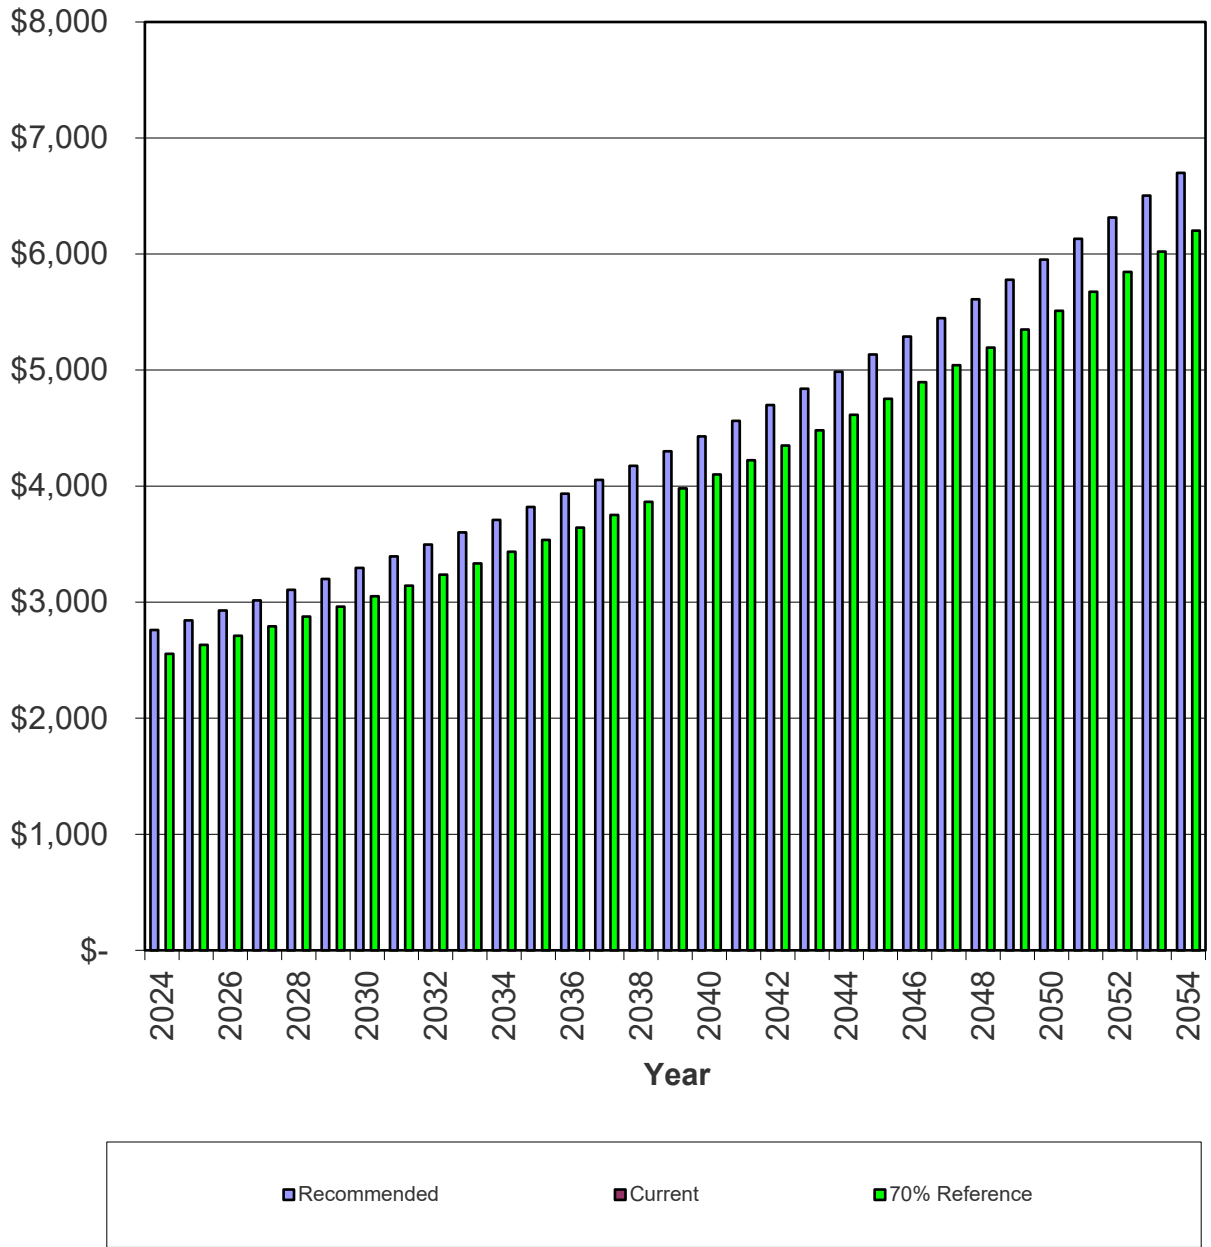

Component Funding Information

ID	Component Name	UL	RUL	Quantity	Average Current Cost	Ideal Balance	Current Fund Balance	Monthly
105	Roofs - Replace	25	3	Approx. 30,570 SF	\$161,000	\$141,680	\$13,299	\$1,029.36
120	Rain Gutters/Downspouts - Replace	30	6	Approx. 1,280 LF	\$13,500	\$10,800	\$0	\$71.93
204	Front Doors - Repaint	10	5	(14) Doors	\$2,500	\$1,250	\$0	\$39.96
217	Building Exteriors - Repaint	8	3	Approx. 12,670 SF	\$23,000	\$14,375	\$0	\$459.53
302	Vinyl Siding - Replace	50	30	Approx 1,155 SF	\$15,000	\$6,000	\$0	\$47.95
401	Asphalt - Major Rehab	30	10	Approx. 19,890 SF	\$65,000	\$43,333	\$0	\$346.32
402	Asphalt - Seal Coat	5	2	Approx. 19,890 SF	\$8,000	\$4,800	\$4,800	\$255.74
403	Concrete - Partial Repair/Replace	10	3	Minimal SF	\$2,500	\$1,750	\$0	\$39.96
607	Balcony Decks - Replace	30	10	Approx. 100 SF	\$2,500	\$1,667	\$0	\$13.32
690	Balcony Railing - Replace	50	10	Approx. 60 LF	\$4,500	\$3,600	\$0	\$14.39
1003	Chain Link Fencing - Replace	40	20	Approx. 1,450 LF	\$52,500	\$26,250	\$0	\$209.79
1602	Exterior Light Fixtures - Replace	20	3	(62) Fixtures	\$11,500	\$9,775	\$0	\$91.91
1812	Landscaping & Irrigation System - Renovate	20	9	Moderate SF	\$17,500	\$9,625	\$0	\$139.86
					\$379,000	\$274,905	\$18,099	\$2,760

Current Fund Balance as a percentage of Ideal Balance: 7%



Yearly Cash Flow

Year	2024	2025	2026	2027	2028
Starting Balance	\$18,099	\$161,364	\$195,656	\$222,349	\$35,946
<i>Reserve Income</i>	\$33,120	\$34,114	\$35,137	\$36,191	\$37,277
<i>Interest Earnings</i>	\$145	\$179	\$209	\$129	\$55
<i>Special Assessments</i>	\$110,000	\$0	\$0	\$0	\$0
Funds Available	\$161,364	\$195,656	\$231,002	\$258,669	\$73,278
Reserve Expenditures	\$0	\$0	\$8,653	\$222,723	\$0
Ending Balance	\$161,364	\$195,656	\$222,349	\$35,946	\$73,278

Year	2029	2030	2031	2032	2033
Starting Balance	\$73,278	\$108,722	\$131,307	\$161,660	\$203,798
<i>Reserve Income</i>	\$38,395	\$39,547	\$40,733	\$41,955	\$43,214
<i>Interest Earnings</i>	\$91	\$120	\$146	\$183	\$213
<i>Special Assessments</i>	\$0	\$0	\$0	\$0	\$0
Funds Available	\$111,764	\$148,389	\$172,187	\$203,798	\$247,225
Reserve Expenditures	\$3,042	\$17,082	\$10,527	\$0	\$24,908
Ending Balance	\$108,722	\$131,307	\$161,660	\$203,798	\$222,317

Year	2034	2035	2036	2037	2038
Starting Balance	\$222,317	\$160,441	\$171,045	\$205,647	\$250,350
<i>Reserve Income</i>	\$44,511	\$45,846	\$47,221	\$48,638	\$50,097
<i>Interest Earnings</i>	\$191	\$166	\$188	\$228	\$276
<i>Special Assessments</i>	\$0	\$0	\$0	\$0	\$0
Funds Available	\$267,019	\$206,453	\$218,455	\$254,513	\$300,722
Reserve Expenditures	\$106,578	\$35,407	\$12,808	\$4,163	\$0
Ending Balance	\$160,441	\$171,045	\$205,647	\$250,350	\$300,722


Year	2039	2040	2041	2042	2043
Starting Balance	\$300,722	\$348,144	\$401,667	\$441,248	\$498,102
<i>Reserve Income</i>	\$51,600	\$53,148	\$54,742	\$56,385	\$58,076
<i>Interest Earnings</i>	\$324	\$375	\$421	\$470	\$503
<i>Special Assessments</i>	\$0	\$0	\$0	\$0	\$0
Funds Available	\$352,647	\$401,667	\$456,831	\$498,102	\$556,681
Reserve Expenditures	\$4,502	\$0	\$15,583	\$0	\$48,458
Ending Balance	\$348,144	\$401,667	\$441,248	\$498,102	\$508,224

Year	2044	2045	2046	2047	2048
Starting Balance	\$508,224	\$453,489	\$515,586	\$560,626	\$592,062
<i>Reserve Income</i>	\$59,818	\$61,613	\$63,461	\$65,365	\$67,326
<i>Interest Earnings</i>	\$481	\$485	\$538	\$576	\$626
<i>Special Assessments</i>	\$0	\$0	\$0	\$0	\$0
Funds Available	\$568,523	\$515,586	\$579,586	\$626,568	\$660,014
Reserve Expenditures	\$115,034	\$0	\$18,959	\$34,506	\$0
Ending Balance	\$453,489	\$515,586	\$560,626	\$592,062	\$660,014

Year	2049	2050	2051	2052	2053
Starting Balance	\$660,014	\$723,387	\$795,573	\$780,546	\$374,108
<i>Reserve Income</i>	\$69,346	\$71,426	\$73,569	\$75,776	\$78,049
<i>Interest Earnings</i>	\$692	\$759	\$788	\$577	\$386
<i>Special Assessments</i>	\$0	\$0	\$0	\$0	\$0
Funds Available	\$730,052	\$795,573	\$869,930	\$856,899	\$452,543
Reserve Expenditures	\$6,665	\$0	\$89,384	\$482,791	\$54,576
Ending Balance	\$723,387	\$795,573	\$780,546	\$374,108	\$397,967



Yearly Reserve Expenditures - Graph

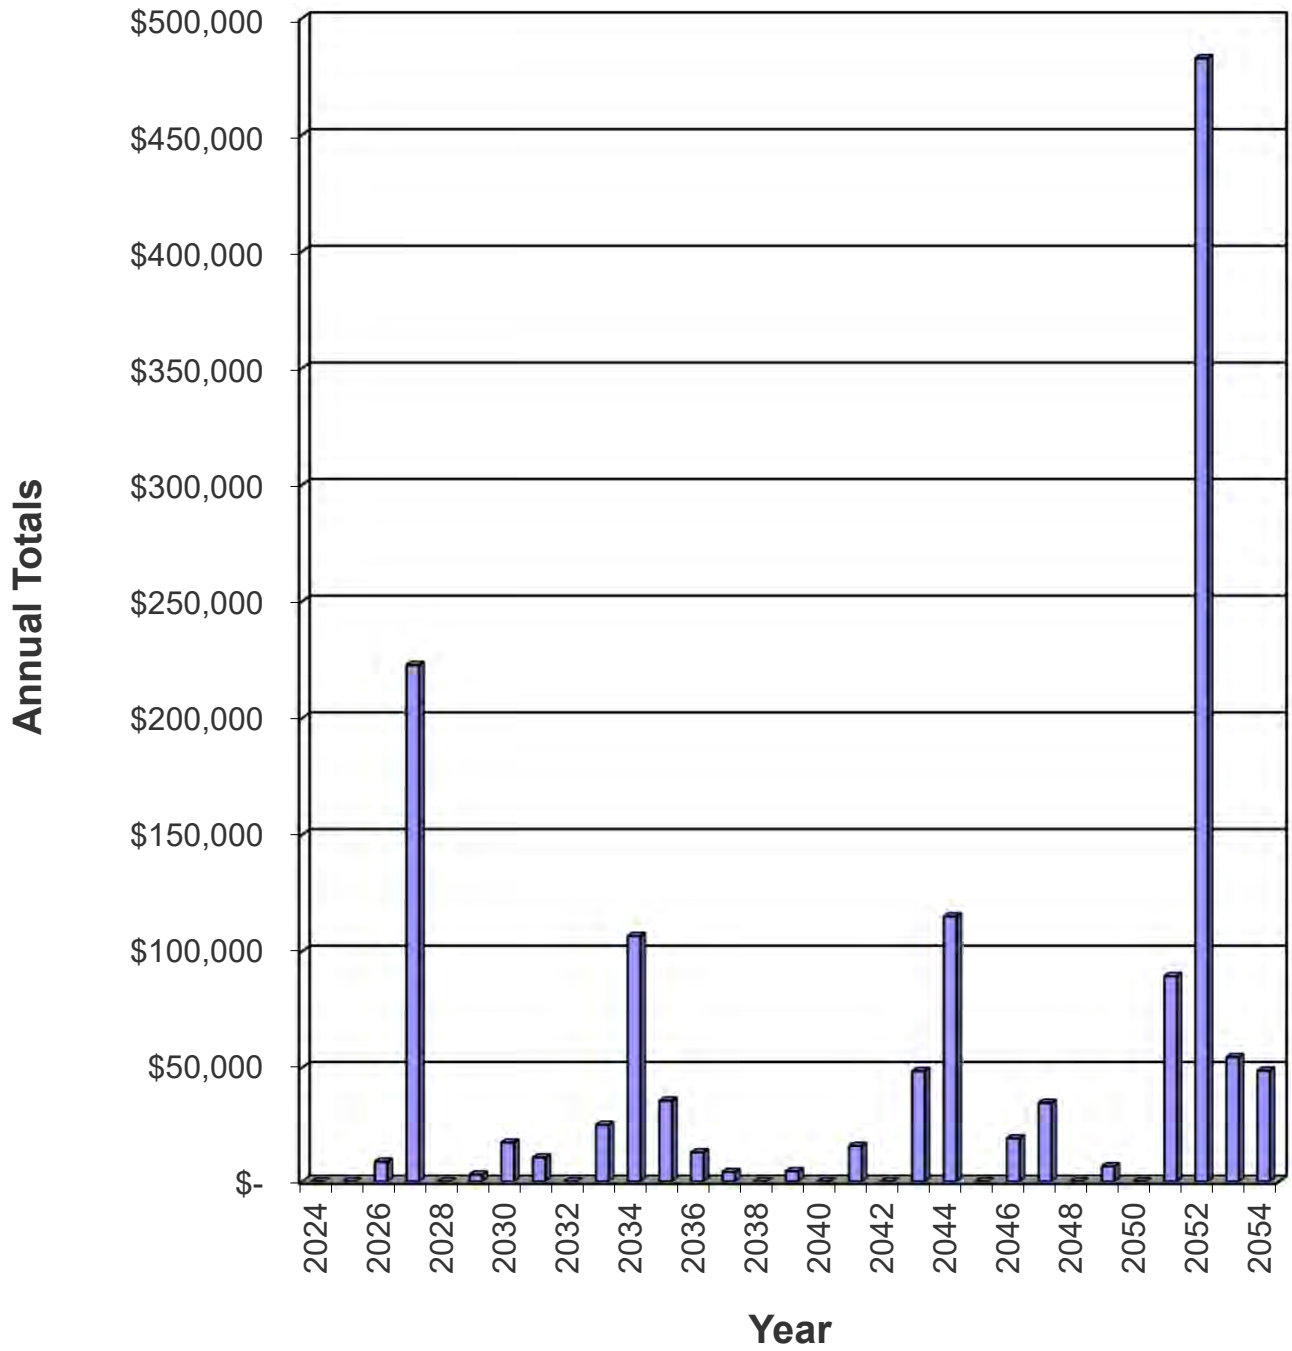

Projected Reserve Expenditures by Year

Year	ID #	Component Name	Projected Cost	Total Per Annum
2024		No Expenditures Projected		\$0
2025		No Expenditures Projected		\$0
2026	402	Asphalt - Seal Coat	\$8,653	\$8,653
2027	105	Roofs - Replace	\$181,103	
	217	Building Exteriors - Repaint	\$25,872	
	403	Concrete - Partial Repair/Replace	\$2,812	
	1602	Exterior Light Fixtures - Replace	\$12,936	\$222,723
2028		No Expenditures Projected		\$0
2029	204	Front Doors - Repaint	\$3,042	\$3,042
2030	120	Rain Gutters/Downspouts - Replace	\$17,082	\$17,082
2031	402	Asphalt - Seal Coat	\$10,527	\$10,527
2032		No Expenditures Projected		\$0
2033	1812	Landscaping & Irrigation System - Renovate	\$24,908	\$24,908
2034	401	Asphalt - Major Rehab	\$96,216	
	607	Balcony Decks - Replace	\$3,701	
	690	Balcony Railing - Replace	\$6,661	\$106,578
2035	217	Building Exteriors - Repaint	\$35,407	\$35,407
2036	402	Asphalt - Seal Coat	\$12,808	\$12,808
2037	403	Concrete - Partial Repair/Replace	\$4,163	\$4,163
2038		No Expenditures Projected		\$0
2039	204	Front Doors - Repaint	\$4,502	\$4,502
2040		No Expenditures Projected		\$0
2041	402	Asphalt - Seal Coat	\$15,583	\$15,583
2042		No Expenditures Projected		\$0
2043	217	Building Exteriors - Repaint	\$48,458	\$48,458
2044	1003	Chain Link Fencing - Replace	\$115,034	\$115,034
2045		No Expenditures Projected		\$0
2046	402	Asphalt - Seal Coat	\$18,959	\$18,959
2047	403	Concrete - Partial Repair/Replace	\$6,162	
	1602	Exterior Light Fixtures - Replace	\$28,344	\$34,506
2048		No Expenditures Projected		\$0
2049	204	Front Doors - Repaint	\$6,665	\$6,665
2050		No Expenditures Projected		\$0
2051	217	Building Exteriors - Repaint	\$66,317	
	402	Asphalt - Seal Coat	\$23,067	\$89,384
2052	105	Roofs - Replace	\$482,791	\$482,791
2053	1812	Landscaping & Irrigation System - Renovate	\$54,576	\$54,576

Component Evaluation

Comp #: 105 Roofs - Replace



Location: **Building Roofs**

Quantity: **Approx. 30,570 SF**

Life Expectancy: **25** *Remaining Life:* **3**

Best Cost: **\$146,000**

Estimate to replace

Worst Cost: **\$176,000**

Higher estimate

Source of Information: CSL Cost Database

Observations:

We recommend consulting a roofing expert to assess the condition of the roofs and approximately how many years of life is left on each section. We recommend funding to replace this component approximately every 20 - 25 years. Remaining life based on current average age and condition.

General Notes:

Comp #: 120 Rain Gutters/Downspouts - Replace



Location: **Building Exterior**

Quantity: **Approx. 1,280 LF**

Life Expectancy: **30** *Remaining Life:* **6**

Best Cost: **\$12,000**

Estimate to replace

Worst Cost: **\$15,000**

Higher estimate

Source of Information: CSL Cost Database

Observations:

The rain gutters and downspouts are in fair condition. We recommend funding to replace this component approximately every 25 - 30 years. Remaining life based on current age and condition.

General Notes:

Comp #: 204 Front Doors - Repaint



Location: **Building Exterior**

Quantity: **(14) Doors**

Life Expectancy: **10** *Remaining Life:* **5**

Best Cost: **\$2,000**

Estimate to repaint

Worst Cost: **\$3,000**

Higher estimate

Source of Information: CSL Cost Database

Observations:

The painted door surfaces are in good to fair condition. We recommend funding to repaint this component approximately every 8 - 10 years. Remaining life based on current age and condition.

General Notes:

Comp #: 212 Balcony Railing - Repaint



Location: **Building Exterior**

Quantity: **Approx. 60 LF**

Life Expectancy: **N/A** *Remaining Life:*

Best Cost: **\$0**

Worst Cost: **\$0**

Source of Information:

Observations:

Repaint as a part of Component #217 Building Exteriors - Repaint.

General Notes:

Comp #: 217 Building Exteriors - Repaint



Location: **Building Exterior**

Quantity: **Approx. 12,670 SF**

Life Expectancy: **8** *Remaining Life:* **3**

Best Cost: **\$20,000**

Estimate to repaint

Worst Cost: **\$26,000**

Higher estimate

Source of Information: CSL Cost Database

Observations:

The painted wood siding surfaces are in fair condition. We recommend funding to repair/repaint this component approximately every 8 - 10 years. Remaining life based on current age and condition.

General Notes:

Comp #: 302 Vinyl Siding - Replace



Location: **Building Exterior**

Quantity: **Approx 1,155 SF**

Life Expectancy: **50** *Remaining Life:* **30**

Best Cost: **\$12,000**

Estimate to replace

Worst Cost: **\$18,000**

Higher estimate

Source of Information: CSL Cost Database

Observations:

The vinyl siding is in good condition. We recommend funding to replace this component approximately every 40 - 50 years. Remaining life based on current age and condition.

General Notes:

Comp #: 401 Asphalt - Major Rehab



Location: **Community Streets**

Quantity: **Approx. 19,890 SF**

Life Expectancy: **30** *Remaining Life:* **10**

Best Cost: **\$60,000**

Estimate for major rehab

Worst Cost: **\$70,000**

Higher estimate

Source of Information: CSL Cost Database

Observations:

The asphalt surfaces are in fair condition. We recommend funding for a major rehab of this component approximately every 25 - 30 years. Remaining life based on current age and condition.

General Notes:

Comp #: 402 Asphalt - Seal Coat



Location: **Community Streets**

Quantity: **Approx. 19,890 SF**

Life Expectancy: **5** *Remaining Life:* **2**

Best Cost: **\$7,000**

Estimate for seal coat

Worst Cost: **\$9,000**

Higher estimate

Source of Information: CSL Cost Database

Observations:

The asphalt seal coat is in fair condition. We recommend funding to seal this component approximately every 3 - 5 years. Remaining life based on current age.

General Notes:

Comp #: 403 Concrete - Partial Repair/Replace



Location: **Common Area**

Quantity: **Minimal SF**

Life Expectancy: **10** *Remaining Life:* **3**

Best Cost: **\$2,000**

Allowance to repair/replace

Worst Cost: **\$3,000**

Higher allowance

Source of Information: CSL Cost Database

Observations:

The concrete is in good to fair condition. This component has an extended useful life under normal conditions. We recommend funding to make repairs and partially replace this component approximately every 10 years. Remaining life based on current age.

General Notes:

Comp #: 607 Balcony Decks - Replace



Location: **Building Exterior**

Quantity: **Approx. 100 SF**

Life Expectancy: **30** *Remaining Life:* **10**

Best Cost: **\$2,000**

Estimate to replace

Worst Cost: **\$3,000**

Higher estimate

Source of Information: CSL Cost Database

Observations:

The decks are in fair condition. We recommend funding to replace this component every 20 - 30 years. Remaining life based on current age and condition.

General Notes:

Comp #: 690 Balcony Railing - Replace



Location: **Building Exterior**

Quantity: **Approx. 60 LF**

Life Expectancy: **50** *Remaining Life:* **10**

Best Cost: **\$4,000**

Estimate to replace

Worst Cost: **\$5,000**

Higher estimate

Source of Information: CSL Cost Database

Observations:

The deck railing is in fair condition. We recommend funding to replace this component approximately every 40 - 50 years. Remaining life based on current age and condition.

General Notes:

Comp #: 801 Monument Sign - Replace



Location: **Community Entrance**

Quantity: **(1) Sign**

Life Expectancy: **N/A** *Remaining Life:*

Best Cost: **\$0**

Worst Cost: **\$0**

Source of Information:

Observations:

Due to the minimal cost of replacing this component, reserve funding is not appropriate. Replace as necessary as an operating expense.

General Notes:

Comp #: 1003 Chain Link Fencing - Replace



Location: **Community Perimeter**

Quantity: **Approx. 1,450 LF**

Life Expectancy: **40** *Remaining Life:* **20**

Best Cost: **\$45,000**

Estimate to replace

Worst Cost: **\$60,000**

Higher estimate

Source of Information: CSL Cost Database

Observations:

The chain link fencing is in fair condition. We recommend funding to replace this component approximately every 30 - 40 years. Remaining life based on current age and condition.

General Notes:

Comp #: 1306 Picnic Table - Replace



Location: **Common Area**

Quantity: **(1) Table**

Life Expectancy: **N/A** *Remaining Life:*

Best Cost: **\$0**

Worst Cost: **\$0**

Source of Information:

Observations:

Due to the minimal cost of replacing this component, reserve funding is not appropriate. Replace as necessary as an operating expense.

General Notes:

Comp #: 1602 Exterior Light Fixtures - Replace



Location: **Building Exteriors**

Quantity: **(62) Fixtures**

Life Expectancy: **20** *Remaining Life:* **3**

Best Cost: **\$10,000**

Estimate to replace

Worst Cost: **\$13,000**

Higher estimate

Source of Information: CSL Cost Database

Observations:

The exterior light fixtures are in fair to poor condition. We recommend funding to replace this component approximately every 16 - 20 years. Remaining life based on average age and condition.

General Notes:

Comp #: 1812 Landscaping & Irrigation System - Renovate



Location: **Common Area**

Quantity: **Moderate SF**

Life Expectancy: **20** *Remaining Life:* **9**

Best Cost: **\$15,000**

Allowance to renovate

Worst Cost: **\$20,000**

Higher allowance

Source of Information: CSL Cost Database

Observations:

The landscaping and irrigation system appear to be in good condition. We recommend funding for an allowance to renovate this component approximately every 20 years. Remaining life based on current age.

General Notes:

Glossary of Commonly Used Words And Phrases

(Provided by the National Reserve Study Standards of the Community Associations Institute)

Cash Flow Method – A method of developing a reserve funding plan where contributions to the reserve fund are designed to offset the variable annual expenditures from the reserve fund. Different reserve funding plans are tested against the anticipated schedule of reserve expenses until the desired funding goal is achieved.

Component – Also referred to as an “Asset.” Individual line items in the Reserve Study developed or updated in the physical analysis. These elements form the building blocks for the Reserve Study. Components typically are: 1) Association responsibility, 2) with limited useful life expectancies, 3) have predictable remaining life expectancies, 4) above a minimum threshold cost, and 5) required by local codes.

Component Full Funding – When the actual (or projected) cumulative reserve balance for all components is equal to the fully funded balance.

Component Inventory – The task of selecting and quantifying reserve components. This task can be accomplished through on-site visual observations, review of association design and organizational documents, a review of established association precedents, and discussion with appropriate association representatives.

Deficit – An actual (or projected reserve balance), which is less than the fully funded balance.

Effective Age – The difference between useful life and remaining useful life (UL - RUL).

Financial Analysis – The portion of the Reserve Study where current status of the reserves (measured as cash or percent funded) and a recommended reserve contribution rate (reserve funding plan) are derived, and the projected reserve income and expenses over time is presented. The financial analysis is one of the two parts of the Reserve Study.

Fully Funded Balance – An indicator against which the actual (or projected) reserve balance can be compared. The reserve balance that is in direct proportion to the fraction of life “used up” of the current repair or replacement cost of a reserve component. This number is calculated for each component, and then summed together for an association total.

$$\text{FFB} = \text{Current Cost} * \text{Effective Age} / \text{Useful Life}$$

Fund Status – The status of the reserve fund as compared to an established benchmark, such as percent funded.

Funding Goals – Independent of calculation methodology utilized, the following represent the basic categories of funding plan goals:

- *Baseline Funding*: Establishing a reserve-funding goal of keeping the reserve balance above zero.
- *Component Full Funding*: Setting a reserve funding goal of attaining and maintaining cumulative reserves at or near 100% funded.
- *Threshold Funding*: Establishing a reserve funding goal of keeping the reserve balance above a specified dollar or percent funded amount.

Funding Plan – An association’s plan to provide income to a reserve fund to offset anticipated expenditures from that fund.



Funding Principles –

- Sufficient funds when required
- Stable contributions through the year
- Evenly distributed contributions over the years
- Fiscally responsible

GSF - Gross Square Feet

Life and Valuation Estimates – The task of estimating useful life, remaining useful life, and repair or replacement costs for the reserve components.

LF - Linear Feet

Percent Funded – The ratio, at a particular point in time (typically the beginning of the fiscal year), of the actual (or projected) reserve balance to the ideal fund balance, expressed as a percentage.

Physical Analysis – The portion of the Reserve Study where the component evaluation, condition assessment, and life and valuation estimate tasks are performed. This represents one of the two parts of the Reserve Study.

Remaining Useful Life (RUL) – Also referred to as “remaining life” (RL). The estimated time, in years, that a reserve component can be expected to continue to serve its intended function. Projects anticipated to occur in the current fiscal year have a “0” remaining useful life.

Replacement Cost – The cost of replacing, repairing, or restoring a reserve component to its original functional condition. The current replacement cost would be the cost to replace, repair, or restore the component during that particular year.

Reserve Balance – Actual or projected funds as of a particular point in time (typically the beginning of the fiscal year) that the association has identified for use to defray the future repair or replacement of those major components that the association is obligated to maintain. Also known as “reserves,” “reserve accounts,” or “cash reserves.” In this report the reserve balance is based upon information provided and is not audited.

Reserve Study – A budget-planning tool, which identifies the current status of the reserve fund and a stable and equitable funding plan to offset the anticipated future major common area expenditures. The Reserve Study consists of two parts: The Physical Analysis and the Financial Analysis.

Special Assessment – An assessment levied on the members of an association in addition to regular assessments. Governing documents or local statutes often regulate special assessments.

Surplus – An actual (or projected) reserve balance that is greater than the fully funded balance.

Useful Life (UL) – Also known as “life expectancy.” The estimated time, in years, that a reserve component can be expected to serve its intended function if properly constructed and maintained in its present application of installation.

